
[\[Daytona LE Manual\]](#)

SEGA
Gameworks L.L.C.
Service Bulletin

November 14, 1996

"This Bulletin applies to the Daytona LE Games only "

Problem : Miscellaneous Input control problems (Steering, Brake, Accel not properly operating)

Cause : Bad connections at Bus Bars on bottom of game.

Correction : Perform the correctional procedure listed below.

1. Open Back of game, and locate 4ea Bus Bars on the bottom of cabinet.
2. With a 11/32" nutdriver, tighten all of the terminals on "All 4 " of the bus bars. Note: One of the bars is located under the Pedal Assembly, and the assemble MUST BE REMOVED FOR ACCESS. Be sure to properly align the ring terinals so that they lay flat.
3. If ANY of the nuts cannot be tightened by an 11/32 driver, replace the nut with a 8-32 Hex Nut.

For further information , contact your Sega Distributor, or Sega Technical Services at (415) 802-1750 7:30am-4:30pm Pacific
